

## Miniature Rotary Switches

1. A high-density switch featuring 12 contacts with the same outside diameter as MR 10-contact type.
2. For the terminals, the crimping type is employed and the epoxy sealing is applied to prevent flux entry.
3. Adoption of the wiping mechanism for the contacting area to ensure contacting stability and reliability.

Contact plating.		Silver plated	Gold plated
Rating	Max.	150mA 125VAC	
	Min.	10mA 5V AC/DC	
Initial contact resistance		30mΩ max. (1A 2~4VDC)	30mΩ max. (1.5mA 200μVAC)
Dielectric strength		500VAC 1 minute	
Insulation resistance		100MΩ min. (500VDC)	
Electrical life		10,000 cycles	
Operating force		14.7N·cm max.	
Stopper strength		49N·cm	
Operating temperature range		-10~+65°C	
Storage temperature range		-20~+85°C	

**MR 2 - 6 G - Z**

Series code    Number of poles    Number of position    Contact plating


<b>1</b>	1pole
<b>2</b>	2poles
<b>3</b>	3poles
<b>4</b>	4poles

<b>12</b>	12position
<b>6</b>	6position
<b>4</b>	4position
<b>3</b>	3position

None	Silver plated
<b>G</b>	Gold plated

Standard 140008010241			
Part name	Hex Nut	Lockwasher	Locking Ring
Part No.	140008010241	140008030051	140008020066
Dimensions			
Finish	Nickel plated	Zinc plated	

Panel thickness : 2.5 mm max.

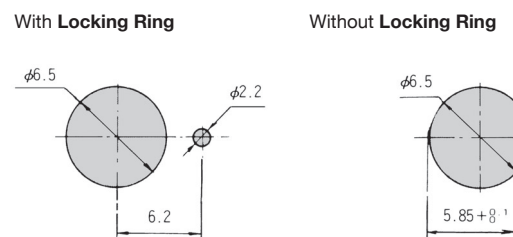


●For **Soldering Specifications** and **Flux Cleaning**, see page 547.

## MR(30° step)

### MR1-12-Z

#### 1-pole 12-position


Terminal numbers are shown on the switch.

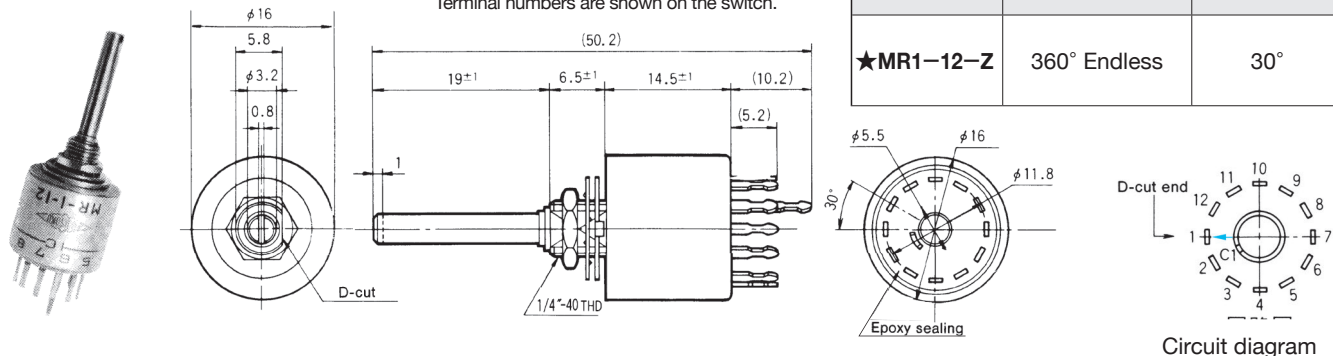

### MR2-6-Z

#### 2-pole 6-position


Terminal numbers are shown on the switch.

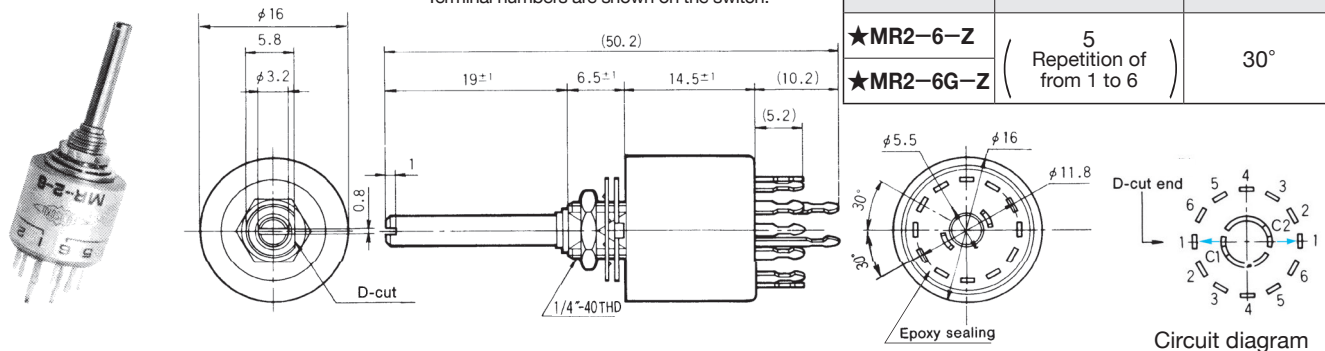

### MR3-4-Z

#### 3-pole 4-position


Terminal numbers are shown on the switch.

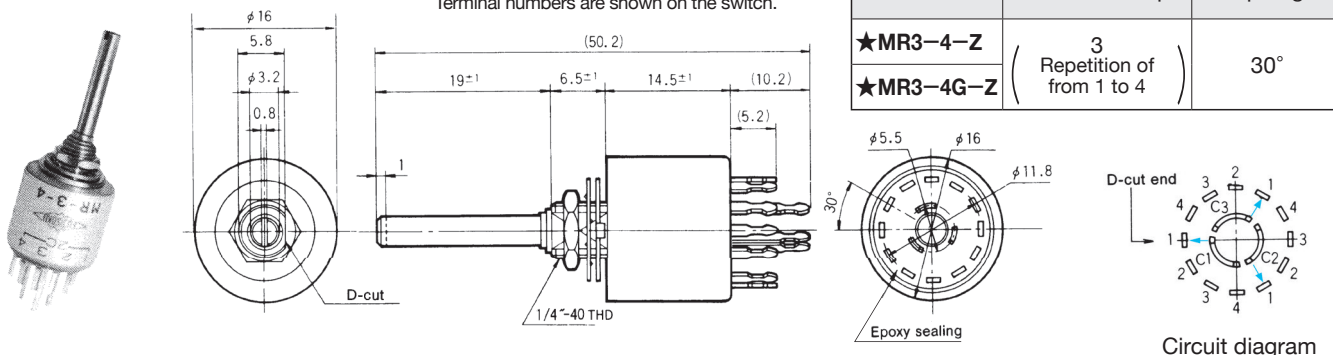

### MR4-3-Z

#### 4-pole 3-position

Terminal numbers are shown on the switch.

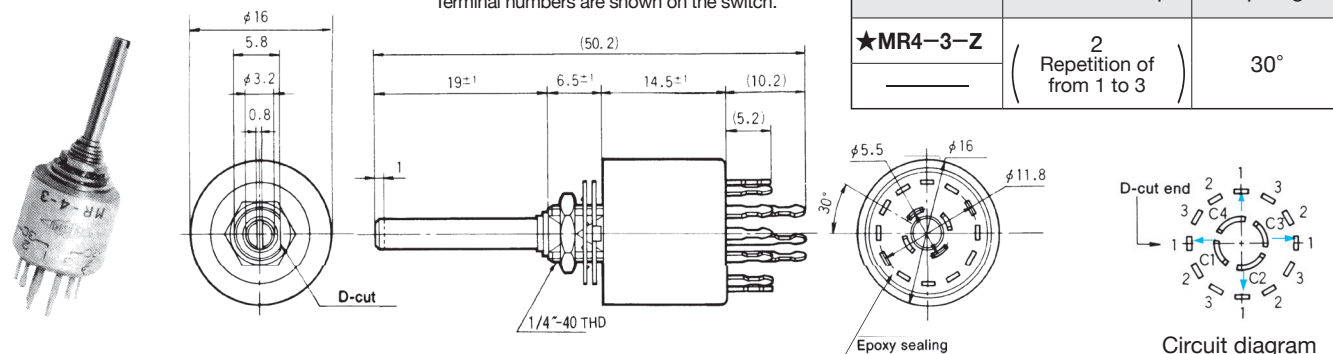

● The circuit diagrams show the switches as viewed from the terminal side with the shaft fully turned in the counter-clockwise direction. Note that the **MR1-12** is of an endless type, check the connecting terminals with a circuit tester.

■ Handling Precautions

1. Soldering Specifications

Manual Soldering  
Device: Soldering iron  
380°C, Max.; 3 seconds, Max.

2. Mounting of Accessories

Mounting of accessories should be done after soldering  
and flux cleaning.

3. Ambient Conditions

Do not use the switches under the environment where the  
silver plating is subjected to contact failures by sulfuric gas,  
ammonia gas or other corrosive gases.  
Under the environment where dust and dirt exist, use  
waterproof type switches.

■ Packaging Specifications

Series	MR•MRE series
Perforated Plastic Bags	25 pcs./pack 